

## Universal™ burnishing tools

For burnishing shafts, faces, tapers, contours, and relatively large IDs (greater than 2.750 inches/69.85mm)

- Boring-bar style and Indexable turning-bolder style designs
- Tool designs to suit any part size or configuration, or any turning machine
- Low surface finishes
- Standard, available off-the-shelf
- Adjustable for optimum burnishing pressure
- Hardened steel or carbide rollers





## Versatility







(Left-band tool shown)

Burnish any size, any configuration, on any turning machine.







UBT-T1














FOR


**BURNISHING OUTSIDE** 

DIAMETERS, FACES,

TAPERS, AND


**CONTOURS** 

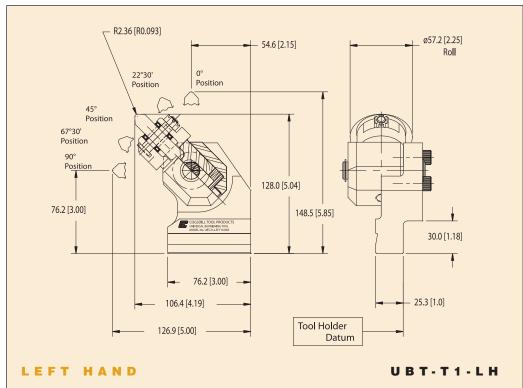

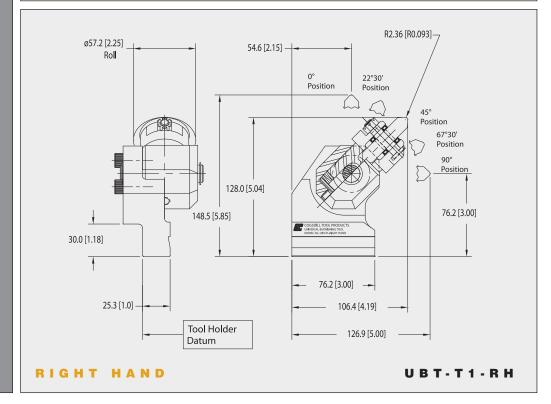






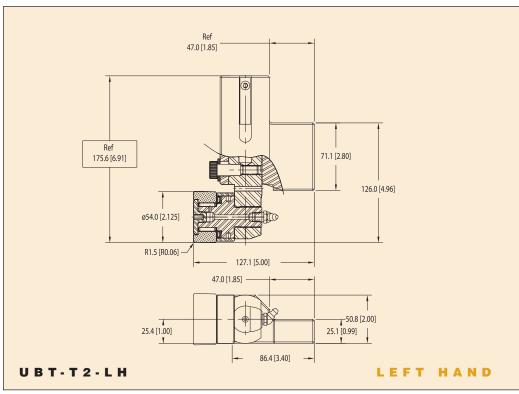



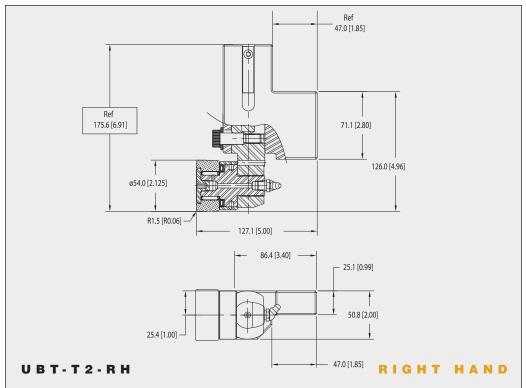








**FOR** 


**BURNISHING LARGE** 

**OUTSIDE DIAMETERS,** 

(GREATER THAN

100mm/4.00 in.)

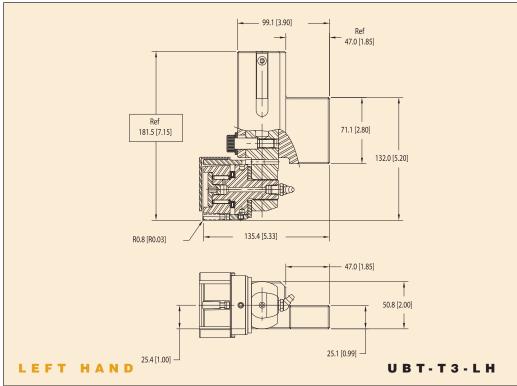

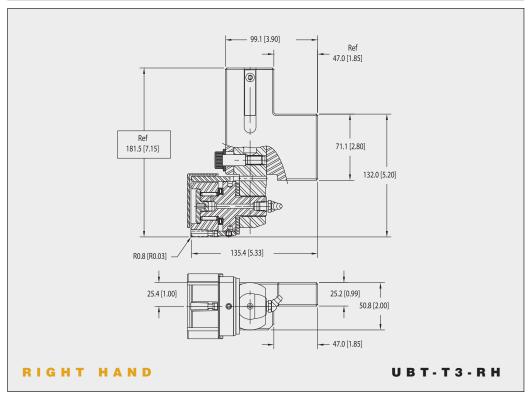





## Set-up and operating instructions for UBT-T Tools


Note:  $UBT^{\text{TM}}$  single-roll burnishing tools do not have the advantage of an overlapping effect as with multi-roll tools, and for this reason slower feed rates and/or multiple passes over the part may be required in order to produce the desired finish.

#### UBT-T1 tool set-up

Loosen the load *adjusting screw*. Retighten the *adjusting screw* until it comes into contact with the spring. Continue to tighten screw 1/2 turn past snug. This is a recommended starting point for mild steel.

Adjustments can be made to the burnishing force to achieve optimum finish. Tighten the *adjusting screw* clockwise one turn to increase the burnishing force, or counterclockwise to reduce the force.

Roll orientation is adjustable in 22°-30' increments. Loosen *mounting screws* two turns. Lift *housing* from *shank*. Rotate to desired position, making sure castellations are engaged. Tighten *mounting screws*.

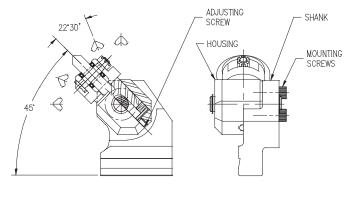


Left hand style shown

#### UBT-T2 tool set-up

Loosen the load *adjusting screw*. Retighten the *adjusting screw* until it comes into contact with the spring. Continue to tighten screw four turns past snug. This is a recommended starting point for mild steel.

Adjustments can be made to the burnishing force to achieve optimum finish. Tighten the *adjusting screw* clockwise to increase the burnishing force, six turns total, or counterclockwise to reduce the force.

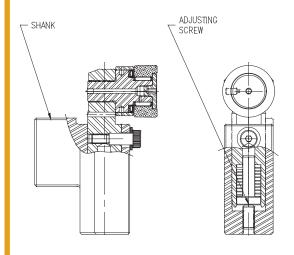

Left hand style shown


#### UBT-T3 tool set-up

Loosen the load *adjusting screw*. Retighten the *adjusting screw* until it comes into contact with the spring. Continue to tighten screw two turns past snug. This is a recommended starting point for mild steel.

Adjustments can be made to the burnishing force to achieve optimum finish. Tighten the load *adjusting screw* clockwise to increase the burnishing force, six turns total, or counterclockwise to reduce the force.

To index to a new roll station, pull off *cover*. Loosen *locking screws* 

and slide cage forward approximately 0.157 (4.0mm) until it disengages from pin. Rotate cage approximately 60°, until *pin* aligns with slot in cage, and push back. Tighten locking screws and replace cover in position shown.

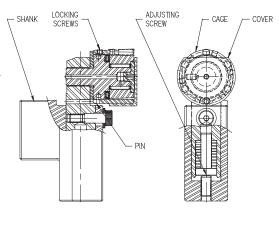

Left hand style shown







### Set-up and operating instructions for UBT-T tools

### UBT-T tool operation

Mount any UBT-T tool in the desired turning station. Use a UBT-T tool that corresponds with the respective turning tool. Bring the tool into contact with the part to be burnished; contact has occurred when you see the mandrel rotating.

Feed the tool another 0.003-0.005 inch (0.08-0.13mm) into the part to provide interference between the roll

and part so that the roll will float in its spring travel. Interference should not be used to increase burnishing force; burnishing force should only be adjusted with the load adjusting screws. This ensures the tool can be fed on/off the part and across interruptions without damage to the tool or workpiece.

For optimum results and long tool

life, coolant is required. Any soluble, synthetic, or straight oil can be used. Whenever possible, and for best results, the tool should be fed towards the spindle when burnishing diameters and towards the centerline when burnishing faces. (Note: UBT-T2 and UBT-T3 tools cannot be used to burnish faces.)

ROLLS FOR UBT-T TOOLS		
ITEM NO.	TOOL TYPE	ROLL TYPE & RADIUS
UBT-006	UBT-T1	HARDENED STEEL, .093 IN. (2.36MM)
UBT-007	UBT-T1	HARDENED STEEL, .030 IN. (0.76MM)
UBT-010	UBT-T1	CARBIDE, .093 IN. (2.36MM)
UBT-015	UBT-T2	HARDENED STEEL, .060 IN. (1.52MM)
UBT-016	UBT-T2	CARBIDE, .060 IN. (1.52MM)
6100-708-00312	UBT-T3	HARDENED STEEL, .030 IN. (0.76MM)

### Speed and feed recommendations for UBT-T tools

SPEED	
SFM	M/MIN.
750	230

FEED	
IPR	MM/REV.
0.001/0.006	0.02/0.15

### Lubrication of UBT-T tools

All UBT-T tools should be periodically greased (approximately every 24 hours of operation). We recommend the use of high-quality Lithium complex grease.





## **UBT-T Tools with force gauge**

- Adaptable to all new UBT-T2 and UBT-T3 tools.
- Gauge available in English units (pounds) or metric units (newtons).



UBT-T2 with gauge

COMPLETE TOOL		
UBT-T2-LH-GS	LH TOOL W/ENGLISH (POUNDS) GAUGE	
UBT-T2-LH-GM	LH TOOL W/METRIC (NEWTONS) GAUGE	
UBT-T2-RH-GS	RH TOOL W/ENGLISH (POUNDS) GAUGE	
UBT-T2-RH-GM	RH TOOL W/METRIC (NEWTONS) GAUGE	

GAUGE ASSEMBLY	
UBT-T2-LH-GSA	LH ENGLISH (POUNDS) GAUGE
UBT-T2-LH-GMA	LH METRIC (NEWTONS) GAUGE
UBT-T2-RH-GSA	RH ENGLISH (POUNDS) GAUGE
UBT-T2-RH-GMA	RH METRIC (NEWTONS) GAUGE

LH- LEFT HAND RH - RIGHT HAND



UBT-T3 with gauge

COMPLETE TOOL		
UBT-T3-LH-GS	LH TOOL W/ENGLISH (POUNDS) GAUGE	
UBT-T3-LH-GM	LH TOOL W/METRIC (NEWTONS) GAUGE	
UBT-T3-RH-GS	RH TOOL W/ENGLISH (POUNDS) GAUGE	
UBT-T3-RH-GM	RH TOOL W/METRIC (NEWTONS) GAUGE	

GAUGE ASSEMBLY		
UBT-T3-LH-GSA	LH ENGLISH (POUNDS) GAUGE	
UBT-T3-LH-GMA	LH METRIC (NEWTONS) GAUGE	
UBT-T3-RH-GSA	RH ENGLISH (POUNDS) GAUGE	
UBT-T3-RH-GMA	RH METRIC (NEWTONS) GAUGE	

LH- LEFT HAND RH - RIGHT HAND




## **UBT-T Tools force gauge assembly**



### UBT-T force gauge adjustment procedure

### UBT-T gauge adjustment

- Adjust **load adjusting screw** to touch internal spring.
- Set indicator to "0" with **zero indicator screw**.
- Tighten **load adjusting screw** until desired load is shown on indicator.
- Touch off on part.
- Compress tool onto part approximately 5 pounds (22 newtons) as shown on the indicator.

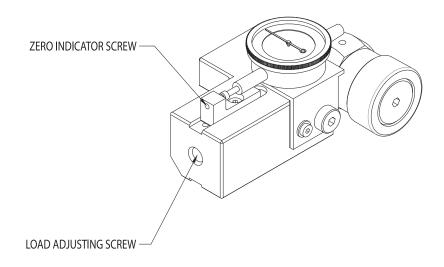














## Boring-bar style

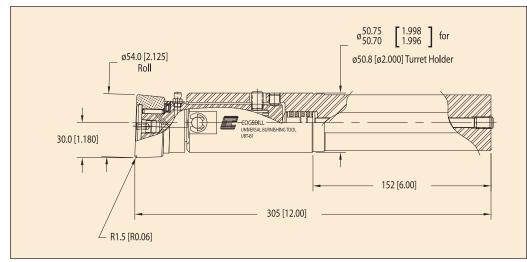




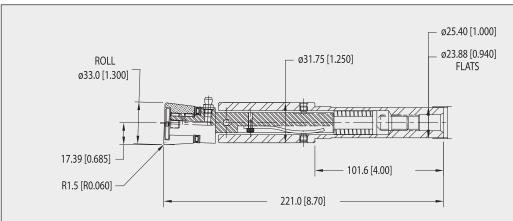



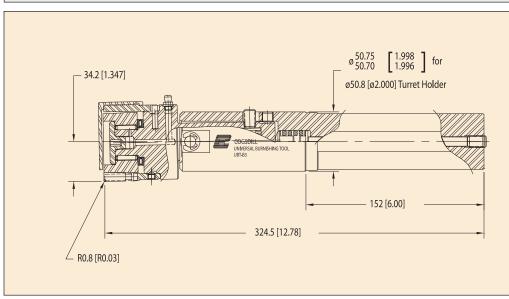

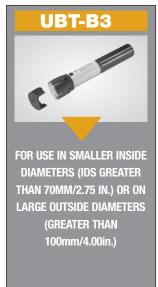






# Set-up and operating instructions for UBT-B Tools

Note:  $UBT^{TM}$  single-roll burnishing tools do not have the advantage of an overlapping effect as with multi-roll tools, and for this reason slower feed rates and/or multiple passes over the part may be required in order to produce the desired finish.

#### UBT-B1 tool set-up

Loosen the load *adjusting screws*. Retighten the *adjusting screws* until they come into contact with the spring. Continue to tighten both screws one turn past snug. This is a recommended starting point for mild steel.

Adjustments can be made to the burnishing force to achieve optimum finish. Tighten the *adjusting screws* clockwise to increase the burnishing force, three turns total, or counterclockwise to reduce the force.

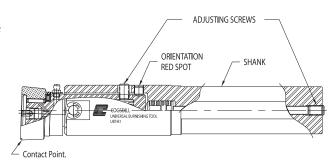


#### UBT-B2 tool set-up

Loosen the load *adjusting screws*. Retighten the *axial adjusting screw* until it comes into contact with the spring. Continue to tighten three turns past snug. This is a recommended starting point for mild steel.

Tighten the *radial adjusting screw* until it comes into contact with the spring. Continue to tighten 1-1/2 turns past snug. Do not tighten beyond this point; overloading this screw will not allow the tool to float on its spring travel and will impede tool function.

Adjustments can be made to the burnishing force to achieve optimum finish. Tighten the *axial adjusting screw* only. Turn clockwise to increase burnishing force, for a total of 6-1/2 turns, or counterclockwise to reduce the force.

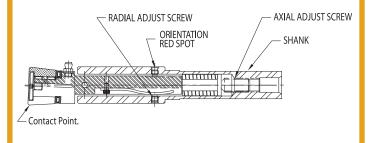


#### UBT-B3 tool set-up

Loosen the load *adjusting screws*. Retighten the *adjusting screws* until they come into contact with the spring. Continue to tighten both screws one turn past snug. This is a recommended starting point for mild steel.

Adjustments can be made to the burnishing force to achieve optimum finish. Tighten the *adjusting screws* clockwise to increase the burnishing force, for a total of three turns, or counterclockwise to reduce the force.

To index to a new roll station, pull off *cover*. Loosen *locking screws* and slide *cage* forward approximately 0.157 (4.0mm) until it disengages from *pin*. Rotate *cage* approximately 60°, until *pin* aligns with slot in *cage*, and push back. Tighten *locking screws* and replace *cover* in position, exposed *roll* opposite orientation red spot.

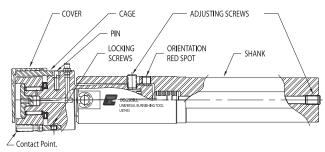

### Set-up and operating instructions for UBT-B tools

#### UBT-B tool operation

Mount any UBT-B tool in the desired boring bar station. (Note: The red orientation spot *must* be opposite the contact point.) Bring the tool into contact with the part to be burnished.

Feed the tool another 0.003-0.005 inch (0.08-0.13mm) into the part to provide interference between the roll and part so that the roll will float in

its spring travel. Interference should not be used to increase burnishing force; burnishing force should only be adjusted with the load adjusting screws. This ensures the tool can be fed on/off the part and across interruptions without damage to the tool or workpiece.

For optimum results and long tool life, coolant is required. Any soluble,

synthetic, or straight oil can be used. Whenever possible, and for best results, the tool should be fed towards the spindle when burnishing diameters and towards the centerline when burnishing faces. (Note: the UBT-B3 tool cannot be used to burnish faces.)

ROLLS FOR UBT-B TOOLS		
ITEM NO.	TOOL TYPE	ROLL TYPE & RADIUS
UBT-001	UBT-B1	HARDENED STEEL, .060 IN. (1.52MM)
UBT-002	UBT-B1	CARBIDE, .060 IN. (1.52MM)
UBT-003	UBT-B1	HARDENED STEEL, .030 IN. (0.76MM)
UBT-018	UBT-B2	HARDENED STEEL, .060 IN. (1.52MM)
UBT-019	UBT-B2	CARBIDE, .060 IN. (1.52MM)
6100-708-00312	UBT-B3	HARDENED STEEL, .030 IN. (0.76MM)

### Speed and feed recommendations for UBT-B tools

SPEED	
SFM	M/MIN.
750	230

FEED	
IPR	MM/REV.
0.001/0.006	0.02/0.15

### Lubrication of UBT-B tools

All UBT-B tools should be periodically greased (approximately every 24 hours of operation). We recommend the use of high-quality Lithium complex grease.

# Universal<sup>™</sup> Burnishing Tools






- ► Compact design for use where limited space is available.
- Designed for, but not limited to, use on multi-spindle automatic and screw type machines.
- ► Available in both "LH" left hand and "RH" right hand models.
- ▶ Designed to burnish outside diameters.
- Low surface finishes attainable.
- ► Adjustable for optimum burnishing pressure.
- Low cost replaceable burnishing roll.
- Standard and available off-the-shelf.
- ▶ Refer to Burnishing catalog #500 or visit us online www.cogsdill.com for operating information.

# Universal Burnishing Tools



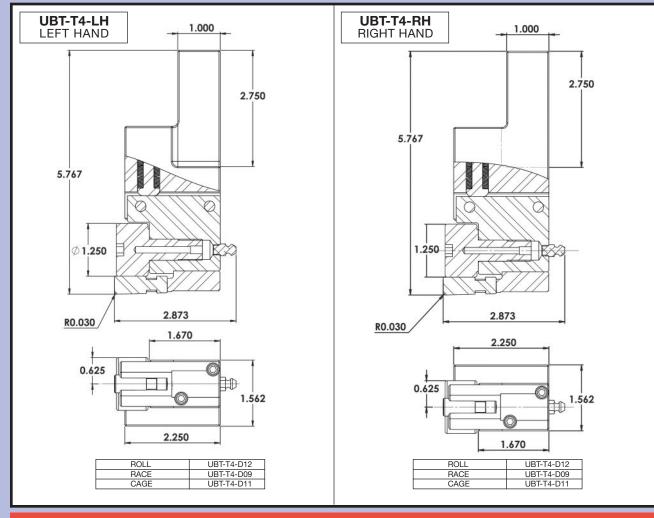







Universal Burnishing Tools Cospil Tools




Any size. Any configuration. On any turning machine.

cogsdill.com

# **Tool Specifications**




The T-Series comes in both left hand and right hand configurations. Dimensions shown are for left hand tools.

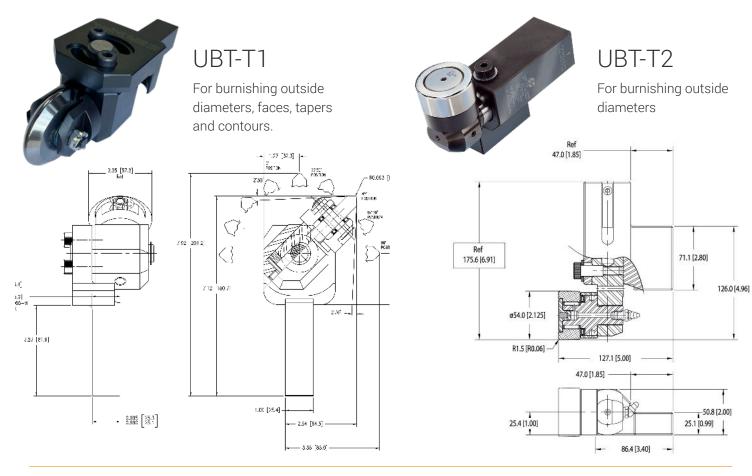



## UBT-T3


For burnishing large outside diameters (greater than 4 inches / 100mm).

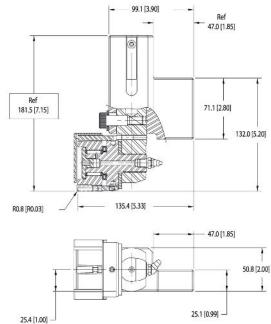





### UBT-T4

A compact design for use where limited space is available.

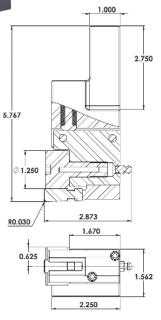

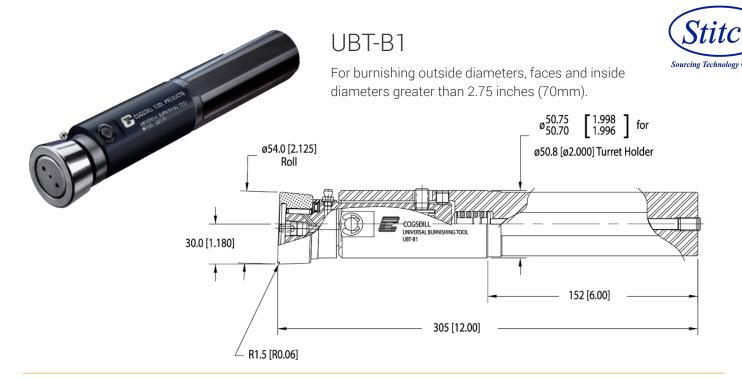



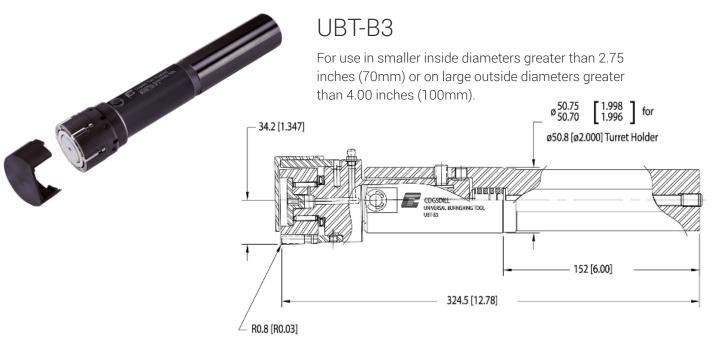

## Universal Burnishing Tools (UBT)



Versatile Burnishing

Cogsdill Universal Burnishing Tools are designed for burnishing shafts, faces, tapers, contours, and relatively large IDs (greater than 2.750 inches (69.85mm).

- · Boring-Bar style and Indexable turning-holder style designs
- · Turning-Holder styles available with force gauges.
- Tool designs to suit any part size or configuration, or any turning machine
- · Low surface finishes
- · Standard, available off-the-shelf
- Adjustable for optimum burnishing pressure
- Hardened steel or carbide rollers

We hold a range of tools and spare Carbide and HSS rolls in stock.















## Two styles are available:

### **Boring-Bar Style**

The Cogsdill UBT-B series are designed for use in a machine turret configuration on a CNC lathe, where differing diameters are required from a single tool set-up.

### **Turning-Holder Style**

The Cogsdill UBT-T series are designed for use in an indexable turning holder configuration, mounted to a machine turret on a lathe.